


LAND CORNER RECORD

| | | | | |
|------------------|--|---------------------|-----------|--|
| Index: Z-9 | Corner: Common Corner between Sections 32 and 33 | | | State of Indiana - Hoosier National Forest |
| Section: 32 & 33 | Township: 7N | Range: 2E | P.M.: 2nd | County: Lawrence |
| Coordinate: | Lat./N: 1364048.85 | Long./E: 3170349.76 | | Datum: NAD83 IN West Zone, US Survey Feet |


CORNER HISTORY: (Chronological history of corner)

| 1.) Date of Survey: | Surveyor: | Monument: | Recording Information: | | Monument Photograph: |
|----------------------------------|---|--|------------------------------------|-----------|---|
| 9/9/1993 | Ken Anderson L.S. #80040545 | A stamped 3-1/4" aluminum monument set | USDA Forest Service Bedford, IN | | |
| Reference Objects: | Species: | Diameter: | Bearing: | Distance: | |
| | Sugar Maple | 6" | S42°E | 25.60' | |
| | Chestnut Oak | 18" | N48°W | 28.40' | |
| | Chestnut Oak | 13" | S18°W | 33.50' | |
| Record evidence of prior survey: | This monument was set to replace a scribed stone that was broken off at the base. The stone was set in 1880 by George Vannay recorded in the Monroe County Surveyor's Bk. 2, Pg. 314. | | | | |
| 2.) Date of Survey: | Surveyor: | Monument: | Recording Information: | |  |
| 12/11/2014 | Robert Stone USFS Survey Tech | A stamped 3-1/4" aluminum monument | USDA Forest Service Bedford, IN | | |
| Reference Objects: | Species: | Diameter: | Bearing: | Distance: | |
| | Sugar Maple | 12" | S42°E | 25.60' | |
| | Chestnut Oak | 21" | N48°W | 28.40' | |
| | Chestnut Oak | 16" | S18°W | 33.50' | |
| Record evidence of prior survey: | | | | | |

ACCESSORIES: Bearing and distance from monument to witness object.

| Reference Objects: | Object or Tree Species: | Diameter: | Bearing: | Distance: |
|------------------------|---|-----------|----------|-----------|
| | Sugar Maple | 13" | S40°E | 25.35' |
| | Rock Chestnut Oak | 22" | N44°W | 28.48' |
| | Rock Chestnut Oak | 18" | S15°W | 33.55' |
| Monument Found or Set: | A 3-1/4" aluminum monument stamped "T7N R2E S.32 S.33 S.5 1993 S0545" was found 0.5' above grade. | | | |


MONUMENT SKETCH

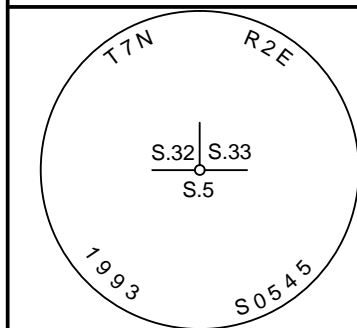

NARRATIVE REFERENCE:

The monument is a 3-1/4" aluminum monument stamped "T7N R2E S.32 S.33 S.5 1993 S0545", found 0.5' above grade, with a carsonite post 3.0' west. This monument is located on the east side of a north-south running ridge, +/- 40' east of the ridge top, +/- 40' south of a 24" Red Oak that had fallen down and is lying east-west, +/- 275' west of a drainage.

SECTION DIAGRAM

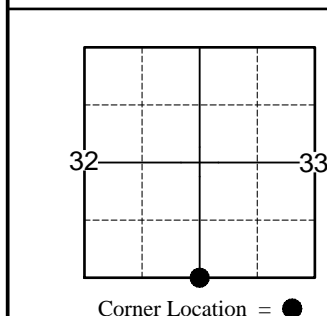

PERPETUATION RECORD:

The accepted monument was found undisturbed and referenced to three existing bearing trees. The three existing bearing trees were recovered from a Land Corner Record by Robert Stone, dated 12/11/2014.

The existing bearing trees were marked with a new blaze, scribed B.T., bearing tree sign, paint, and mag nail.

Accepted by the Monroe County Survey Review Board on September 10, 2019.

Section: 4 T6N R2E

Prepared By: BRCJ

(Project#3-1005)

Date: 5/2019

Referenced on a BRCJ boundary survey of Hoosier National Forest land in Section 4-T6N-R2E (Lawrence Co.)

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 32

Township: 7 North


Range: 2 East

Corner ID: Polk i-25

Monument Description & Remarks: $3\frac{1}{4}$ " Aluminum Disc.

References On File: Kenneth Anderson survey, Forest Service on the Hoosier National Forest (1993), on file in Recorder Office in Recorder's Survey Book 3, page 17

RECOVERY TIE DRAWING
Field Book 26 Page No. 28
Field Book 33 Page No. 48

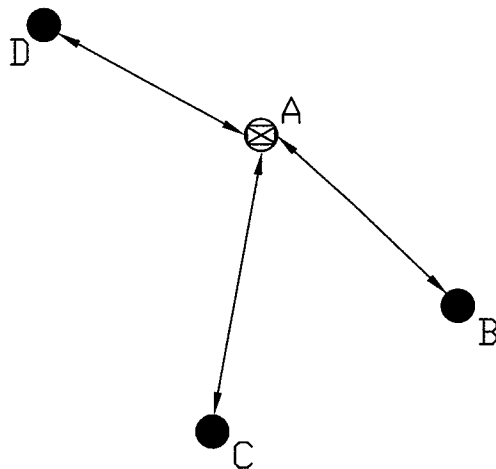

A - $3\frac{1}{4}$ " Aluminum Disc
B - S 38° E 25.26' to MAG
nail in 6" Sugar Maple
C - S 16° W 33.52' to MAG
nail in 13" Chinquapin Oak
D - N 44° W 28.09' to MAG
nail in 17" Chinquapin Oak

Not To Scale
Compass Bearing Magnetic North



I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 4th day of December, 2000.



Administered by the Monroe County Surveyor Review Board

Date: 11/10/2009